

Radon Inspection Report

Measurement of Radon Concentration in Indoor Air

Report nr: 2700005145201904291046
Serial nr: 2700005145

Report generated date: 4/29/19 10:46

Measurement Address:

[REDACTED]
East Stroudsburg , PA 18360
USA

Measurement performed by:

Thom Schiavone
Wild Blue Group LLC
8090 Running Valley Rd
Stroudsburg , PA 18360
thom@wildbluegroup.com
USA

Room	Floor	Measurement Start	Measurement End	Measured Value
		4/23/19 13:18	4/25/19 13:18	2.3 pCi/L

Location _____ Date April 29, 2019 Signature _____

Detailed Measurement Data


Units	Min	Max	Average
Radon [pCi/L]	0.3	5.5	2.3
Temperature [°F]	69.8	76.6	73.5
Humidity [%rH]	34	43	39
Pressure [kPa]	97.69	98.55	98.14

Radon measurements for hour 1 to hour 48


	Radon [pCi/L]	Hour	Radon [pCi/L]	Hour	Radon [pCi/L]
	2.8	4/24/19 05:18	4.6	4/24/19 21:18	2.8
4/23/19 13:18	1.1	4/24/19 06:18	2.8	4/24/19 22:18	2.4
4/23/19 14:18	1.4	4/24/19 07:18	2.8	4/24/19 23:18	3.1
4/23/19 15:18	1.4	4/24/19 08:18	3.6	4/25/19 00:18	3.1
4/23/19 16:18	1.8	4/24/19 09:18	3.2	4/25/19 01:18	1.0
4/23/19 17:18	0.7	4/24/19 10:18	2.4	4/25/19 02:18	4.2
4/23/19 18:18	2.1	4/24/19 11:18	1.7	4/25/19 03:18	1.7
4/23/19 19:18	2.5	4/24/19 12:18	0.3	4/25/19 04:18	3.5
4/23/19 20:18	1.4	4/24/19 13:18	0.3	4/25/19 05:18	2.4
4/23/19 21:18	2.8	4/24/19 14:18	0.3	4/25/19 06:18	5.5
4/23/19 22:18	2.8	4/24/19 15:18	1.4	4/25/19 07:18	3.1
4/24/19 00:18	0.7	4/24/19 16:18	1.0	4/25/19 08:18	3.8
4/24/19 01:18	0.3	4/24/19 17:18	1.4	4/25/19 09:18	5.2
4/24/19 02:18	2.5	4/24/19 18:18	1.4	4/25/19 10:18	3.1
4/24/19 03:18	1.4	4/24/19 19:18	1.0	4/25/19 11:18	3.4
4/24/19 04:18	3.5	4/24/19 20:18	0.3	4/25/19 12:18	3.5

Radon Chart

-

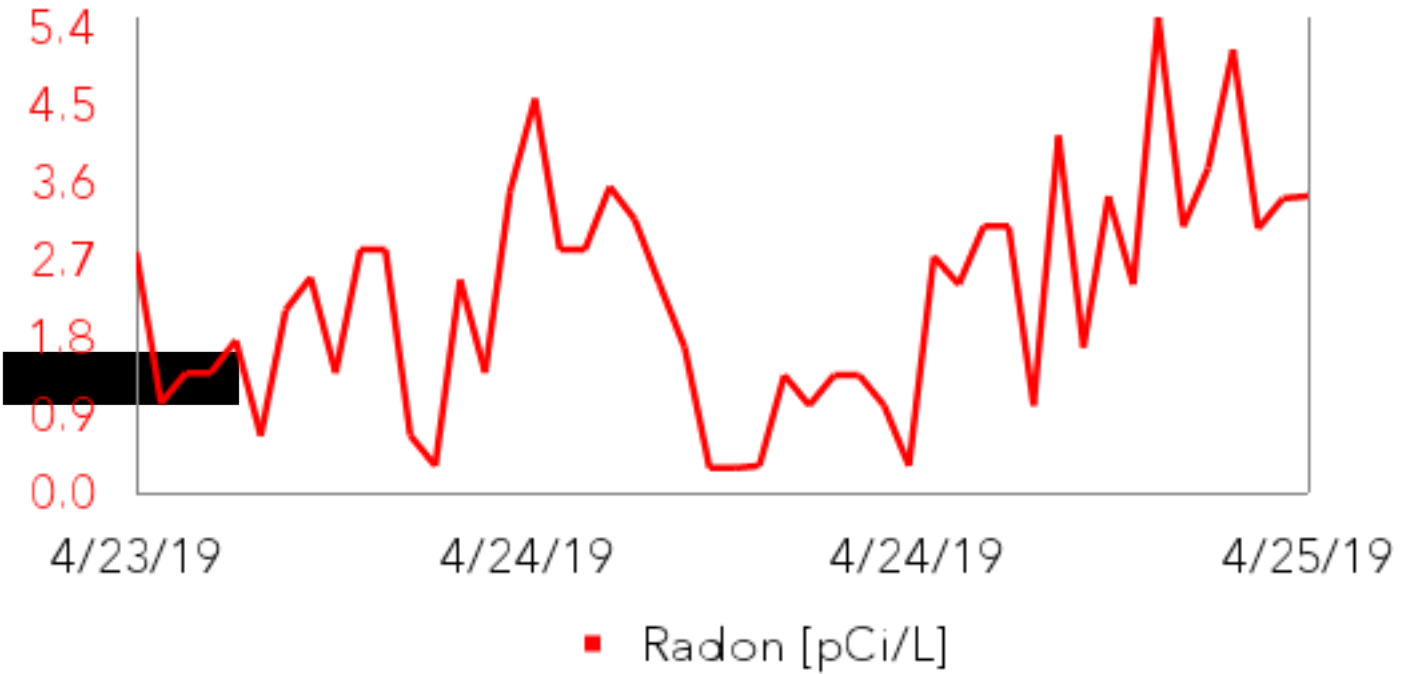

Humidity and Temperature Chart

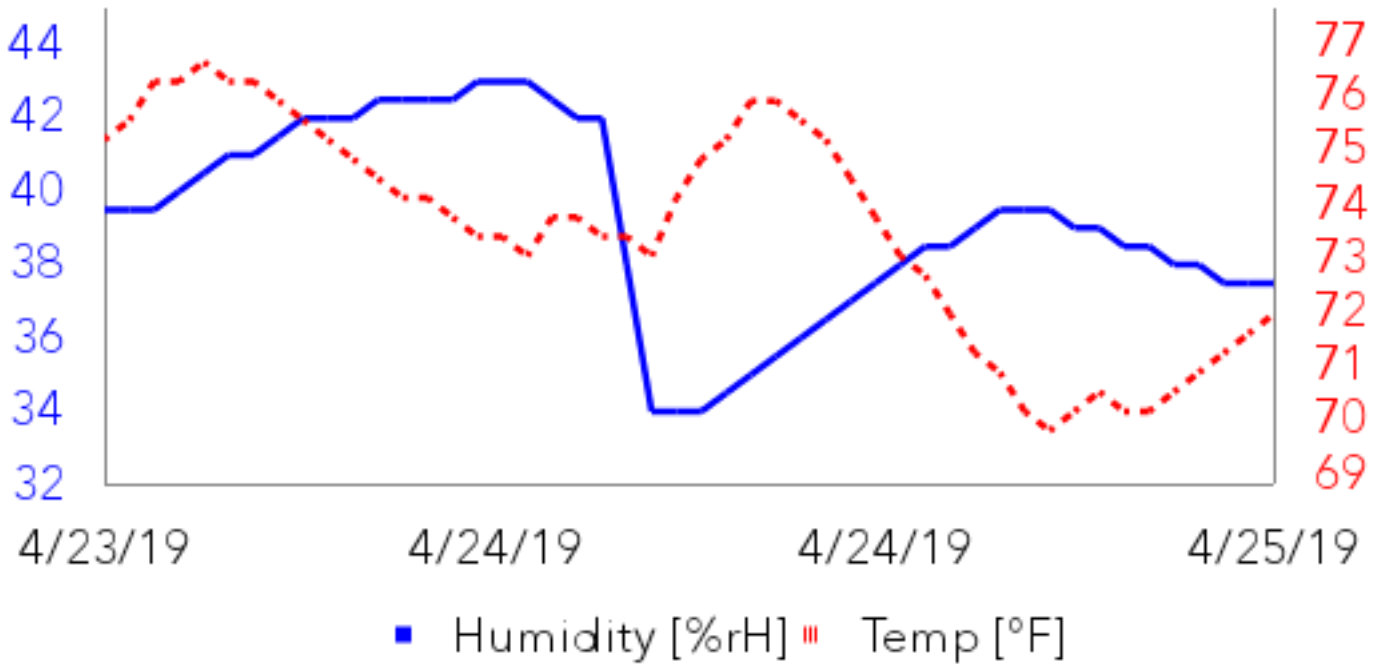

Pressure Chart

-

